

Polycom® UC Software 5.8.5

Applies to Polycom® VVX® Business Media Phones,
Polycom® VVX® Business IP Phones, and Polycom®
SoundStructure® VoIP Interface Phones

Contents

What's New	2
Security Updates.....	3
Installation	3
Version History	6
Language Support	11
Resolved Issues.....	12
Known Issues.....	15
Updates to Previous Software Releases	16
Get Help	34
Copyright and Trademark Information	35

What's New

Polycom Unified Communications (UC) Software 5.8.5 is a maintenance release for OpenSIP and Skype for Business deployments. These release notes provide important information on software updates, phone features, and known issues.

Important Note About Use of UC Software in Skype for Business Deployments

Customers in Skype for Business deployments should only use software releases that Microsoft has qualified or maintenance releases built on a qualified release.

Microsoft qualification may fall behind Polycom Generally Available dates for UC Software, hence we request customers to check whether a release has been qualified before deploying new software. For all latest Microsoft qualified releases visit the [Polycom UC Software for Skype for Business Deployments](#) page for a list of qualified releases.

New Features and Enhancements

Polycom UC Software 5.8.5 includes the following enhancement.

OpenSSL Version Upgrade

OpenSSL is upgraded from version 1.0.2j to version 1.0.2q for Polycom VVX phones.

Configuration File Enhancements

The following table lists configuration file enhancements that include new or changed parameters for the Polycom UC Software 5.8.5 release. For more information on using configuration parameters to enable or disable features, see the latest *Polycom UC Software Administrator Guide* for your release, available at [Latest Polycom UC Software Release](#).

`voIpProt.SIP.ignoreEntityHost`

0 (default) – Doesn't ignore the host part of the entity received in the XML body of NOTIFY for a dialog event.

1- Ignores the host part of the entity received in the XML body of NOTIFY for a dialog event.

`voIpProt.H323.p2pURLDialingThroughGK`

0 (default) - VVX phones don't route H.323 URL dialing calls through the gatekeeper.

1 - VVX phones route H.323 URL dialing calls through the gatekeeper.

up.offHookSpeedDialShortcut.enable

1 (default) - VVX phones display the speed dial shortcut for one or two digits followed by # in the off-hook state.

0 - VVX phones don't display the speed dial shortcut for one or two digits followed by # in the off-hook state.

video.codecPref.XH264UC

Sets the Microsoft H.264 UC video codec preference priority.

0 (default)

0 – 1

video.codecPref.XUlpFecUC

Sets the forward error correction (FEC) codec priority.

0 (default)

0 – 6

feature.ResetHostSettings.enabled

1 (default) – Enables the settings when device switched to guest mode.

0 – Disables the settings when device switched to guest mode.

Security Updates

See the [Polycom Security Center](#) for information about known and resolved security vulnerabilities.

Installation

Consider the following information when installing or updating to Polycom UC Software 5.8.5.

- For best results, deploy the BToE Connector 3.8.0 application before deploying UC Software 5.8.5.

BToE Connector 3.8.0 is backward compatible with previous versions of VVX firmware, but Polycom doesn't recommend running previous versions of the BToE software with UC Software 5.8.5.

- Before updating your VVX 1500 business media phone to UC Software 5.8.5, make sure that you update the phone to BootBlock 3.0.4.

For more information, see Technical Bulletin 695: [Upgrading the Polycom VVX 1500 Business Media Phone to UC Software 5.2.0](#)

- If you're running UC Software 5.8.5 and the BToE Connector 3.4.1, the phone doesn't lock with the computer.
- When you upgrade to UC Software 5.8.5 and use the VVX-D60_DSW-170 package, the VVX D60 base station upgrades followed by the VVX D60 handset upgrade.

This change in sequence is a one-time change to address a VVX D60 handset upgrade issue detected in the earlier package.

Download the Distribution Files

To download UC Software 5.8.5, you can choose the combined UC Software package or the split UC Software package, both in ZIP file format. The combined version contains all files for all phone models. The split software package is smaller, downloads more quickly, and contains sip.ld files for each phone model. This enables you to choose provisioning software for your phone model and maintain software versions for each model in the same root directory.

For general use, Polycom recommends using the split resource file that corresponds to the phone models for your deployment. To match the correct UC software resource file to your phone model, refer to [Understand the Combined and Split ZIP Files](#). If you provision your phones centrally using configuration files, download the corresponding resource file and extract the configuration files to the provisioning server. Make sure that you maintain the folder hierarchy in the ZIP file.

The current build ID for the sip.ld and resource files is **UCS 5.8.5.1256rts20**.

Understand the Combined and Split ZIP Files

To understand the files distributed in the combined ZIP file, refer to the following table.

Understand the Combined and Split ZIP Files

<i>Distributed Files</i>	<i>File Purpose and Application</i>	<i>Combined</i>	<i>Split</i>
3111-40250-001.sip.ld	SIP application executable for VVX 101 business media phones.	No	Yes
3111-40450-001.sip.ld	SIP application executable for VVX 201 business media phones.	No	Yes
3111-46135-002.sip.ld	SIP application executable for VVX 300 business media phones.	No	Yes
3111-48300-001.sip.ld	SIP application executable for VVX 301 business media phones.	No	Yes
3111-46161-001.sip.ld	SIP application executable for VVX 310 business media phones.	No	Yes
3111-48350-001.sip.ld	SIP application executable for VVX 311 business media phones.	No	Yes
3111-46157-002.sip.ld	SIP application executable for VVX 400 business media phones.	No	Yes
3111-48400-001.sip.ld	SIP application executable for VVX 401 business media phones.	No	Yes
3111-46162-001.sip.ld	SIP application executable for VVX 410 business media phones.	No	Yes
3111-48450-001.sip.ld	SIP application executable for VVX 411 business media phones.	No	Yes

<i>Distributed Files</i>	<i>File Purpose and Application</i>	<i>Combined</i>	<i>Split</i>
3111-44500-001.sip.ld	SIP application executable for VVX 500 business media phones.	No	Yes
3111-48500-001.sip	SIP application executable for VVX 501 business media phones.	No	Yes
3111-44600-001.sip.ld	SIP application executable for VVX 600 business media phones.	No	Yes
3111-48600-001.sip	SIP application executable for VVX 601 business media phones.	No	Yes
2345-17960-001.sip.ld	SIP application executable for VVX 1500 business media phones.	No	Yes
3111-48810-001.sip.ld	SIP application executable for VVX 150	No	Yes
3111-48820-001.sip.ld	SIP application executable for VVX 250	No	Yes
3111-48830-001.sip.ld	SIP application executable for VVX 350	No	Yes
3111-48840-001.sip.ld	SIP application executable for VVX 450	No	Yes
3111-33215-001.sip.ld	SIP application executable for SoundStructure VoIP Interface phones.	No	Yes
3111-17823-001.dect.ld	SIP application executable for VVX D60 Wireless Handset and Base Station.	No	Yes
sip.ld	Concatenated SIP application executable.	Yes	No
dect.ver	Text file detailing build-identification(s) for the VVX D60 handset.	Yes	Yes
sip.ver	Text file detailing build-identification(s) for the release.	Yes	Yes
000000000000.cfg	Master configuration template file.	Yes	Yes
000000000000-directory~.xml	Local contact directory template file. To apply for each phone, replace the (zeroes) with the MAC address of the phone and remove the ~ (tilde) from the file name.	Yes	Yes
applications.cfg	Configuration parameters for microbrowser and browser applications.	Yes	Yes
device.cfg	Configuration parameters for basic device configuration.	Yes	Yes
features.cfg	Configuration parameters for telephony features.	Yes	Yes
firewall-nat.cfg	Contains configuration parameters for telephony features.	Yes	Yes
H323.cfg	Configuration parameters for the H.323 signaling protocol.	Yes	Yes

<i>Distributed Files</i>	<i>File Purpose and Application</i>	<i>Combined</i>	<i>Split</i>
lync.cfg	Contains Lync/Skype for Business specific configuration parameters.	Yes	Yes
pstn.cfg	Contains parameters for Public Switched Telephone Network (PSTN) use.	Yes	Yes
reg-advanced.cfg	Contains configuration parameters for the line and call registration and advanced phone feature settings.	Yes	Yes
reg-basic.cfg	Configuration parameters for line and call registration and basic phone settings.	Yes	Yes
region.cfg	Configuration parameters for regional and localization settings such as time and date and language.	Yes	Yes
sip-basic.cfg	Configuration parameters for the VoIP server and softswitch registration.	Yes	Yes
sip-interop.cfg	Configuration parameters for the VoIP server, Softswitch registration, and interoperability configuration.	Yes	Yes
site.cfg	Configuration parameters that are set for each site.	Yes	Yes
video.cfg	Configuration parameters for video connectivity.	Yes	Yes
video-integration.cfg	Configuration parameters for Polycom® SoundStation® IP 7000 conference phone and Polycom® HDX® system integration.	Yes	Yes
Welcome.wav	Startup welcome sound effect.	Yes	Yes
LoudRing.wav	Sample loud ringer sound effect.	Yes	Yes
Polycom-hold.wav	Sample ringer sound effect.	Yes	Yes
Warble.wav	Sample ringer sound effect.	Yes	Yes
polycomConfig.xsd	Master configuration file that contains the parameters and its values.	Yes	Yes

Version History

This following table lists the release history of Polycom Unified Communications (UC) Software.

Version History

<i>Release</i>	<i>Release Date</i>	<i>Features</i>
5.8.5	July 2019	This release includes OpenSSL version upgrade and other important field fixes.
5.9.3	May 2019	This release includes the following new and enhancement features: <ul style="list-style-type: none"> • DHCP IP Address Cache • TLS Support for BToE • Polycom Cloud Connector • Enhancement to Wi-Fi Settings
5.8.4	May 2019	This release includes enhancement to Wi-Fi settings and other important security fixes.
6.0.0	April 2019	This release includes important field fixes and support for the following features: <ul style="list-style-type: none"> • Guest Soft Key Customization • Plantronics Headset Settings • TLS Support for BToE • Improved Flexible Line Key Assignments for Static BLFs and Enhanced Feature Keys • Font Size Customization • Enhanced Feature Keys – BLF Support • Advanced uaCSTA • VVX Pagination • Key System Emulation • DHCP IP Address Cache
5.9.2	March 2019	This release includes important field fixes.
5.6.5	March 2019	This release includes important field fixes.
5.8.3	January 2019	This release includes important field fixes.
5.9.1	January 2019	This release includes enhancement to VLAN ID and Wi-Fi dongle support.

<i>Release</i>	<i>Release Date</i>	<i>Features</i>
5.9.0	December 2018	<p>This release includes important field fixes and support for the following features:</p> <ul style="list-style-type: none"> • Session Traversal Utilities for NAT (STUN) • Device Analytics Support for PDMS-SP • Multilevel Precedence and Preemption (MLPP) for Assured Services - Session Initiation Protocol (AS-SIP) • Support for H.264 Packetization Mode • Enhanced Busy Lamp Field (BLF) • Busy Lamp Field Hold Alerting • Busy Lamp Field (BLF) Spontaneous Call Appearance on Per BLF Basis • Enhanced Feature Key Macro Actions • Retrieve Logs from Support Information Package Page in the Web Configuration Utility • Simple Certificate Enrollment Protocol • Privacy for Call Logs and Contacts • Enhancement to Wireless Network Connectivity • Call Hold Timer • GZIP Encoding of SIP INFO Messages • Enhanced Boss-Admin for VVX Phones • Web Sign In for Skype for Business On-Premise Deployment
5.7.4	November 2018	This release includes important field fixes.
5.8.2	November 2018	<p>This release includes important field fixes and support for the following features:</p> <ul style="list-style-type: none"> • Polycom VVX EM50 Expansion Module support • Important field fixes
5.6.4	October 2018	This release includes important field fixes.
5.7.3	September 2018	This release includes important field fixes.
5.8.1	September 2018	<p>This release includes important field fixes and support for the following features:</p> <ul style="list-style-type: none"> • Polycom EagleEye Mini Camera Support • Forward Error Correction • Simulcast Video • Centralized Conference Control Protocol (CCCP) Conference View Support • Quality of Service (QoS) for Skype for Business Video Calls • Toggling Between Audio-only or Audio-Video Calls
5.6.3	June 2018	<p>This release includes important field fixes and enhancement to include the following new directives to upload and download the certificate and CSV files:</p> <ul style="list-style-type: none"> • CERTIFICATE_DIRECTORY • FLK_DIRECTORY

<i>Release</i>	<i>Release Date</i>	<i>Features</i>
5.8.0	June 2018	<p>This release includes support for the following features:</p> <ul style="list-style-type: none"> • Introducing Polycom VVX Business IP Phones • OpenSIP Enhancements <ul style="list-style-type: none"> ➢ Enhanced IPv4 ICMP Management ➢ Wireless Network Connectivity ➢ Support for REST API ➢ Uploading Logs to a USB Flash Drive ➢ uaCSTA Lines ➢ Enhancements to Check Sync Event ➢ Early Media Call Handling Support ➢ Voice Quality Monitoring Support for the OPUS Codec ➢ BroadSoft Aggregated Self-Presence • Skype for Business Enhancements <ul style="list-style-type: none"> ➢ Hybrid Line Registration ➢ Support for PSTN Gateway on Failover ➢ Reverse Name Lookup
5.7.2	May 2018	This release includes important field fixes.
5.6.2	April 2018	This release includes important field fixes.
5.7.1	March 2018	This release includes important field fixes and enhancement for Direct Inward Dialing number on VVX business media phones.
5.5.4	January 2018	This release includes important field fixes.
5.7.0	December 2017	<p>This release includes support for the following features:</p> <p>OpenSIP Enhancements</p> <p>This release introduced support for BroadSoft User Interface theme, Executive-Assistant Enhancements, Custom BroadSoft Executive-Assistant Enhanced Feature Keys, Client-Side Sorting for Open LDAP servers, Securely Store LDAP Credentials on VVX phones, Voice over Secure IP, Hide the MAC Address, Enhanced E.911, DNS Cache Override, Assured Services - Session Initiation Protocol (AS-SIP), Custom URL Location for Installing LDAP server certificates, Emergency Instant Messages - GENBAND, Default Off-Hook Phone screen, Enhanced Feature Keys Enhancements, Bluetooth Support for VVX Business Media Phones, Reset Phone without Admin Password, Prevent Call Park on Busy Orbits, View Phone Memory Usage Alert.</p> <p>Skype for Business Enhancements</p> <p>This release introduced support for Direct Inward Dialing Number on VVX Platforms, Web Proxy Auto-Discovery (WPAD), Skype for Business SILK Audio Codec, Hot Desking, Common Area Phone User, BToE Widget, Enhancements to Manual Pairing of Phone using BToE.</p>
5.6.1	December 2017	This release includes important field fixes.

<i>Release</i>	<i>Release Date</i>	<i>Features</i>
5.6.0	July 2017	<p>This release includes support for the following features:</p> <p>OpenSIP Enhancements</p> <p>This release introduced support for FIPS 140-2 Compliance Support, Two-Way Active Measurement Protocol support, Caller ID Display from the SIP Invite, BroadSoft Server-Based Call Waiting, Call Line Identification, BroadSoft Server-Based Redial, Remote Party Disconnect Alert Tone, Support for Siren 7 Audio Codec.</p> <p>The BroadSoft Directory now includes the following new directories:</p> <ul style="list-style-type: none"> • Group and Group Common Directory • Enterprise Common Directory • Personal Directory <p>Skype for Business Enhancements</p> <p>This release introduced support for Dial Plan Normalization, Multiple Emergency Number Dial Plan, Skype for Business User Interface Enhancements, Skype for Business Conference Enhancements, Device Lock Enhancements, Profile Picture on Device Lock Screen, Secure Single Sign-On with Third-Party Supporting Solutions, Safe Transfer for Boss-Admin Enhancements, and Busy Options for Incoming Calls.</p> <p>VVX D60 Enhancements</p> <p>This release introduced support for FLK Support in VVX Business Media Phone with VVX D60, Maximum Number of Handset Registrations, VVX D60 Base Station Pairing Permissions, Mac Address Pairing with VVX D60 Base Station, Continuous Attempt to Re-pair with a VVX D60 Base Station, and VVX D60 Call Handoff.</p>
5.5.3	September 2017	This release includes important field fixes.
5.5.2	May 2017	<p>This release includes the following features and field fixes:</p> <ul style="list-style-type: none"> • Enterprise Directory Default Search • Registration Line Address in Status Bar • BroadWorks Anywhere EFK for Soft Keys • Hide Contact Directory and Favorites • Personal Directory • BSFT Server-Based Call Logs • New Call Forwarding Icons • Updated Do Not Disturb Icon • Expanded Support for USB Headsets • Support Added for CDP in VVX D60 Base Station • ALLOW Header in 18x Provisional Responses • Improved BToE device lock
5.5.1	September 2016	This release adds enhancements for the distribution list, QoE, device lock, Polycom BToE manual pairing, user log upload, updated UI for VVX 500 and 600, unified contact store, web sign-in for online deployments.

<i>Release</i>	<i>Release Date</i>	<i>Features</i>
5.5.0	June 2016	This release introduced support for BroadSoft Executive Assistant and Flexible Seating, TR-069, the 3GPP Technical Specification, the IPV6 protocol, Off-hook Call Status control, ability to lock the web configuration utility after failed login attempts, and user interface enhancements.
5.4.3	February 2016	This release introduced the Polycom VVX D60 Wireless Handset and VVX D60 Base Station.
5.4.1	December 2015	This release includes support for the following features: <ul style="list-style-type: none"> • Introduced the Polycom VVX 301/311, 401/411, 501, and 601 business media phones • Flexible line key customization for Skype for Business (EFLK) • Master Key Identifiers (MKI) • Shared Line appearance on Lync • BToE for Windows 10 • Smart Search for Lync ABS • Support for simplified Chinese font on VVX 101
5.4.0A	September 2015	This release includes support for the following features: <ul style="list-style-type: none"> • Microsoft Office 365 and Skype for Business Online • Office365 and Skype for Business Provisioning and Manageability • Time and Date Initial Setup
5.4.0	May 2015	Added support for Alcatel-Lucent CTS features including: <ul style="list-style-type: none"> • Advanced Conference • Shared Call Appearance with Bridge In • Visitor Desk Phone • This release also includes support for the following features: <ul style="list-style-type: none"> • Barge In on Busy Lamp Field Lines • DTMF Relay • SIP Instance • Comfort Noise • Opus Codec • DNS Server Address Override • Global Directory Synchronization • Basic Menu Lock • Additional features including user interface improvements and resolved known issues.
5.3.0	March 2015	Includes support for several Lync, BroadSoft, and OpenSIP features.

Language Support

The VVX phone user interface includes native support for the following languages:

- Arabic, UAE

- Chinese, Traditional
- Chinese, Simplified
- Danish, Denmark
- Dutch, Netherlands
- English, Canada
- English, United Kingdom
- English, United States
- French, Canada
- French, France
- German, Germany
- Italian, Italy
- Japanese, Japan
- Korean, Korea
- Norwegian, Norway
- Polish, Poland
- Portuguese, Brazil
- Russian, Russia
- Slovenian, Slovenia
- Spanish, Spain
- Swedish, Sweden

Resolved Issues

The following table lists the resolved issues in UC Software 5.8.5.

Resolved Issues in UC Software 5.8.5

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Application	EN-138274 EN-112318	In a Skype for Business environment, the phone doesn't provide a call recording option for Centralized Conference Control Protocol (CCCP) calls.
Application	EN-132592	VVX phones don't display application endpoint status correctly when you add a favorite contact.
Application	EN-124637	VVX business media phones don't display the Favorites option in the Directories menu when you enable the BroadSoft directory.
Application	EN-120971	VVX phones lose assigned keys after restarting.
Audio	EN-126222	VVX phones fail to perform consultative call audio transfers to the speaker instead of the headset or handset even if you disable handsfree mode.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Audio	EN-123325	There's an audio delay on VVX phones when you perform a consultative call transfer.
Calling	EN-138272	VVX phones reboot while processing the error response for conference calls.
Calling	EN-136750	When dialing to an anonymous user from the call list, the phone sends acknowledgement with spaces in the SIP request-URI causing network congestion.
Calling	EN-132709	VVX phones fail to dial the number immediately when dialing one or two digits followed by #.
Calling	EN-132528	VVX phones can't make H.323 URL calls to an external number.
Calling	EN-123043	You can't make outgoing calls from a VVX business media phone when the monitored BLF alerts and <code>reg.1.callsPerLineKey</code> parameter is set to 1.
Calling	EN-117877	VVX phones log the hunt group incoming call as a missed call while answering and ending the call by other VVX phone sharing the same registered lines.
Calling	EN-130910	VVX phones delay the call transfer by 20 seconds when Microsoft direct team routing setup is used for O365.
Calling	EN-141961	VVX phone trims the remote number extension while using the BLF key for pickup calls.
Certificate Management	EN-135101	When you connect a VVX phone to the HELD server, the phone doesn't respond with a valid certificate after receiving the request message from the server.
Device Management	EN-136758	When you pair a VVX D60 handset to a VVX phone and receive a call through Automatic Call Distribution (ACD), the first call rings on both the VVX phone and the VVX D60 handset but the second call rings only on the VVX phone.
Device Management	EN-131002	Sometimes, VVX phones fail to complete a consultative transfer.
Device Management	EN-138315	When you pair a VVX phone with VVX D60 handset and click either the DND or Call Forward menus on the handset, a "Not supported" message display.
Device Management	EN-131735	The device transfer type changes to consultative transfer when a guest user signs-into a VVX phone.
General	EN-138268	Users are intermittently signed out from VVX business media phones registered to a Skype for Business server when using the Web Configuration Utility to sign-in.
General	EN-138321	Polycom VVX 601 business media phones reboot while processing the Presence state.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
General	EN-138266	VVX phones lose dial plan information during inband refresh.
General	EN-133994	VVX phones crash after receiving SDP attribute as "a=recvnly" in the initial OFFER.
General	EN-132718	Busy Lamp Field (BLF) line calls don't work if the entity URI received in BLF NOTIFY isn't same as the REGISTRAR server configured.
General	EN-125639	After you complete a consultative transfer, VVX phones display the number "10" when you press the star (*) key when the phone is in an idle state.
General	EN-124645	When refreshing the registration, VVX phones become unregistered when they try to directly query SRV instead of NAPTR due to a transport parameter in the contact header of the 200OK message.
General	EN-124306	When VVX phones receive forwarded calls from an external number, the phones display the last four digits of the forwarding number in the Via field.
General	EN-132586	VVX phones change to the default language after a host user signs in.
Localization	EN-138269	Phone sends En-Us as the default language when inviting far-end PSTN users into a conference.
Network	EN-138265	VVX phones sign in but don't receive calls for 10 to 15 minutes when there is a network interruption.
Network	EN-138267	VVX business media phones don't handle authentication error code correctly on password expiry for the web sign in method.
Network	EN-136569	Sometimes VVX phones fail to receive the Location Information Server (LIS) from the server.
Network	EN-127198	VVX phones failover and send two SUBSCRIBE messages for BLF after receiving the 503 response for the INVITE message.
Network	EN-126676	VVX phones display the call log date as February 7, 2036, while SNTP server responds with the value 0x00000000 or 0xFFFFFFFF.
Network	EN-124786	VVX phones fail to add Session Description Protocol (SDP) while generating the Session Refresh INVITES.
Network	EN-123866	VVX phones don't send DNS refresh queries and REGISTER messages after a few failovers due to an improper DNS resolution sequence.
Network	EN-123348	VVX phones stop sending the Buddy Watch's SIP SUBSCRIBE message after the phone fails to connect to a new proxy server.
Network	EN-123050	Metaswitch registration lines go unregistered due to DNS resolution failure.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Network	EN-122704	VVX phones fail to make an outgoing call and receive a 488 error when you configure the SVC codec for the INVITE request.
Network	EN-130442	VVX phones use the <code>device.sntp.serverName</code> parameter even though the <code>tcpIpApp.sntp.address.overrideDHCP</code> parameter is enabled along with the <code>tcpIpApp.sntp.address</code> parameter.
Peripherals	EN-132589	VVX phones using USB headsets drop an outgoing call when they receive a simultaneous call and another phone with simultaneous ringing answers the simultaneous call.
Security	EN-109564	Weak Cipher-Block Chaining (CBC) Ciphers and MAC Algorithms used by the SSH server have been disabled.
User Interface	EN-136755	When you change the BroadSoft Directory string to the Enterprise Directory string, the corresponding translation of Enterprise Directory updates the support languages on the VVX D60 handset.
User Interface	EN-140911	Sometimes, VVX 601 business media phone screen freezes and fails to respond.
Video	EN-135204	VVX phones fail to publish video capabilities in Presence status.

Known Issues

There are no known issues for this release.

Updates to Previous Software Releases

This section describes the new features and enhancements to previous UC Software releases.

What's New in UC Software 5.8.4

Polycom® Unified Communications (UC) Software 5.8.4 is a maintenance release for OpenSIP and Skype for Business deployments. These release notes provide important information on software updates, phone features, and known issues.

Enhancement to Wi-Fi Settings

Polycom VVX phone now displays the Wi-Fi settings only when a Wi-Fi dongle is connected.

Configuration File Enhancements

The following table lists configuration file enhancements that include new or changed parameters for the Polycom UC Software 5.8.4 release. For more information on using configuration parameters to enable or disable features, see the latest *Polycom UC Software Administrator Guide* for your release, available at [Latest Polycom UC Software Release](#).

Configuration File Enhancements for UC Software 5.8.4

<i>Parameter</i>	<i>Permitted Values</i>	<i>Change Causes Restart or Reboot</i>
<code>feature.wifi.visibilityinmenus.enable</code>	1 (default) – Enables the Wi-Fi settings when the dongle is connected. 0 – Disables the Wi-Fi settings when the dongle is connected.	No

Resolved Issues

The following table lists the resolved issues in UC Software 5.8.4.

Resolved Issues in UC Software 5.8.4

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Calling	EN-130895	VVX business media phones store voicemail URI as a default dial string, so subsequent calls made using short press are stored in the voicemail without ringing on the far end.
Calling	EN-129006	VVX business media phones don't answer the incoming call using the speaker, headset, or handset if you enable alert call feature on BLF monitored line.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
General	EN-122343	VVX phone doesn't send BLF to the subscribe after failover.
General	EN-126704	VVX phone application response is may get sluggish due to the memory leak.
Logs	EN-124009	Fixed security vulnerabilities.
Network	EN-132964	VVX phones fail to receive the Location Information Server (LIS) from the server.
Network	EN-138265	VVX phone is signed in but doesn't receive calls for 10-15 mins when there is a network interruption.

What's New in UC Software 5.8.3

Polycom UC Software 5.8.3 includes the features and functionality of previous releases and includes the following new features:

Wi-Fi Dongle Support

Polycom VVX phones now support the Edimax USB Wi-Fi Dongle (EW-7811UTC) along with the Polycom Wi-Fi wireless network adapter.

Resolved Issues

The following table lists the resolved issues in UC Software 5.8.3.

Resolved Issues in UC Software 5.8.3

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Application	EN-114462	DUT doesn't update the presence information properly.
Application	EN-112576	VVX business media phone reboots while processing Reverse Name Lookup (RNL).
Audio	EN-115014	There's a 5-second audio delay on the VVX phone when you resume a remote held call on a shared phone.
Audio	EN-113821	Response group calls drop when phones receive an early re-invite from the response group server.
Call Management	EN-108233	VVX 150 business IP phones don't disable the Transfer and Hold softkey during an active call when you set the parameter <code>softkey.feature.basicCallManagement.redundant</code> to 0.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Calling	EN-115624	When you initiate a call from a paired Skype for Business client in BToE mode, the termination change is delayed on DUT.
Configuration	EN-113091 EN-111454	VVX phones display speed dial key configuration even if the phone doesn't support the feature. This is applicable to all VVX business media phones except the VVX 1500 business media phone.
Configuration	EN-108767	VVX phones accept the <code>up.accessibilityFeatures</code> parameter, but the parameter is only applicable to the VVX 1500 business media phone.
Configuration	EN-109819	The Directory softkey is displayed in a Skype for Business profile even though the profile doesn't support it.
General	EN-113521	The Field Help and parameter name are missing in the software upgrade section of the Web UI for VVX business media phones.
General	EN-110307	WPAD fails to extract the domain from a specific URL.
General	EN-117348	Rest API management returns an incorrect value for the variable <code>packetsExpected</code> .
Localization	EN-111653	VVX phones don't translate Inactive State to another language other than the default language.
Messages	EN-117115	VVX phones restrict the dialnumber URI length to 64.
Network	EN-111152	VVX phones fail to get an IP address when they receive two server identifiers (Option 54) in a DHCP offer.
Network	EN-112092	DUT fails to upgrade in a remote network using NTLM authentication.
Network	EN-108072	VVX phones use 10Mbit instead of 1Gbps network speed for a PC port.
Network	EN-115239 EN-115241	VVX phones fail to charge devices using the rear USB port.
Provisioning	EN-113080	Server settings override local parameter values because of in-band provisioning.
Reports	EN-117373	SIP reports include incorrect packet loss and Mean Opinion Score (MOS).
Reports	EN-113818	Polycom devices registered with Skype for Business publish different QoE server results than those reported on the QoE site.

<i>Category</i>	<i>Issue No.</i>	<i>Description</i>
Reports	EN-117213	Polycom Skype for Business phones sometimes report inaccurate QoE statistics.
Software Updates	EN-117737 EN-110655	Upgrading to the VVX D60 handset software fails when the base station is assigned with xxx.xxx.xxx.xxx IP address.

What's New in UC Software 5.8.2

Polycom UC Software 5.8.2 includes the features and functionality of previous releases and includes the following new features:

- [Introducing the Polycom VVX EM50 Expansion Module](#)

Introducing the Polycom VVX EM50 Expansion Module

The VVX EM50 expansion module is supported on VVX 450 business IP phones with UC Software 5.8.2 or later.

Users can connect up to two expansion modules to the side USB port on VVX 450 business IP phones. The expansion modules include 30 line keys and three pages for a total of 90 lines on each expansion module. With two expansion modules connected to a VVX 450 phone, the phone has a total of 192 lines.

Hardware Limitations

The following sections detail hardware limitations when using the Polycom VVX EM50 expansion module with a VVX 450 business IP phone.

Power Management

For improved power management, use the corresponding VVX 450 power supply and connect it to the phone instead of relying on PoE to power the phone and two expansion modules.

External USB Cable Connection

VVX 450 phones cannot power expansion modules connected to the phone with an external USB cable. In order for the phone to properly power the expansion module, the expansion module must be connected directly to the phone, and the second expansion module must be connected directly to the first expansion module.

What's New in Polycom UC Software 5.8.2

Polycom Unified Communications (UC) Software 5.8.2 is a maintenance release for Open SIP and Skype for Business deployments. These release notes provide important information on software updates, phone features, and known issues.

New Features and Enhancements

There are no new features in UC Software 5.8.2.

Configuration File Enhancements

The following table lists configuration file enhancements that include new or changed parameters for this Polycom UC Software 5.8.2 release. For more information on using configuration parameters to enable or disable features, see the *Polycom UC Software Administrator Guide* available on the [Polycom Support - Voice](#) site.

Configuration File Enhancements in UC Software 5.8.2

<i>Template</i>	<i>Parameter</i>	<i>Permitted Values</i>	<i>Change Causes Restart or Reboot</i>
site.cfg	sec.uploadDevice.privateKey	0 (default) - While generating a Certificate Signing Request (CSR) from the phone, the device private key doesn't upload to the provisioning server. 1 - The device private key uploads to provisioning server along with the CSR.	No
video.cfg	video.quality	The optimal quality for a video that is sent in a call or a conference. Motion (default) - for VVX 500 and 600 series business media phones. Sharpness (default) - for VVX 1500 business media phone. Motion - for an outgoing video that has motion or movement. Sharpness - for an outgoing video that has little or no movement. Note: If the motion is not selected, moderate to heavy motion can cause some frames to be dropped.	No
feature.cfg	up.display.showFullCallerID	0 (default) - Display the caller ID on the first line. 1 - Display the caller ID on the second line.	No

<i>Template</i>	<i>Parameter</i>	<i>Permitted Values</i>	<i>Change Causes Restart or Reboot</i>
site.cfg	voice.rxQos.maxJitter	<p>The average jitter in milliseconds for wired network interface voice traffic.</p> <p>240 (default)</p> <p>0 to 320</p> <p>maxJitter the wired interface jitter buffer maximum depth is automatically configured to handle this level of intermittent jitter without packet loss.</p> <p>Actual jitter above the average but below the maximum value may result in delayed audio play while the jitter buffer adapts, but no packets are lost. Actual jitter above the maximum value always results in packet loss.</p> <p>If you explicitly specify legacy voice.audioProfile.x.jitterBuffer.* parameters, they are used to configure the jitter buffer and voice.rxQoS parameters are ignored.</p>	Yes

Resolved Issues

The following table lists the resolved issues for this release.

Resolved Issues

<i>Issue ID</i>	<i>Release Found In</i>	<i>Description</i>
EN-96771	5.8.0	The VVX phone doesn't pick up the busy lamp field (BLF) incoming call if you press the line key while the phone is off-hook.
EN-98152	5.6.1	In certain environments, the VVX business media phone can't retrieve the parked call using the BLF line key.
EN-99248	5.7.0	Audio quality is bad when using the handset.
EN-99563	5.5.2	When you configure the Busy Lamp Field feature on VVX business media phones and search for a directory via the directory softkey, the phones return to the Home screen.
EN-100101	5.8.0	While using handsfree, headset or lifting handset to initiate a call, the idle display screensaver continues to stay on VVX business IP phone's screen.
EN-101056	5.7.2	The VVX business media phone web UI help text for the <code>msg.bypassInstantMessage</code> parameter displays incorrect information.
EN-101083	5.7.2	Removed <code>up.onHookDialingEnabled</code> parameter from the code as this parameter is applicable only for Spectralink wireless phones.
EN-101376	5.8.0	VVX phones fail to open the Web Configuration Utility in the browser in Chinese due to the insufficient size of the buffer to hold the Chinese language file. The buffer size was increased to 256MB to hold large files.
EN-101383	5.7.0	When you enable the device lock feature for a guest user, the phone asks to set a PIN lock.
EN-101930	5.8.0	The SRTP status for a call obtained using REST API <code>/api/v1/webCallControl/callStatus</code> is incorrect or missing.
EN-103223	5.8.0	The VVX phones were using TLS version 1.0, which caused a failed connection with TLS version 1.2.
EN-103991	5.6.0, 5.6.1	When entering the PIN code to a conference bridge, some digits play a long tone as if it gets stuck.
EN-104208	5.8.2	Nothing happens when a user long-presses the page key on the expansion module. A short press of page key is used to switch between pages.
EN-104339	5.8.0	The phone crashed during a reboot.

<i>Issue ID</i>	<i>Release Found In</i>	<i>Description</i>
EN-104641	5.5.1	VVX phones fail to get an IP address when they receive two server identifiers (Option 54) in a DHCP offer.
EN-104743	5.6.2	A MADN call is answered on the headset when a user tries to pick up the held MADN call on a remote, shared device using the handset.
EN-104783	5.8.0	VVX business media phones don't send any error response when the phone is in an idle state and receives an INVITE with replace header.
EN-105017	5.8.2	When a flexible line key (FLK) contact is removed from a line on the VVX EM50 expansion module, the page refreshes on the expansion module.
EN-105252	5.5.0, 5.6.0, 5.7.0	After a PTT/Group Paging call, active call audio is split between the speaker and handset when the parameter <code>feature.persistentMute.enabled</code> is set to "1".
EN-105354	5.8.0	The VVX phone does not send events in response to the "MonitorStart" command.
EN-106734	5.7.0	Intermittently, a VVX phone does not register with the backup server after an outage.
EN-107289	5.8.1	Some calls on VVX business media phones display a non-emergency call as an emergency call in a GENBAND environment.
EN-107376	5.7.2	In a Skype for Business environment, the description is missing in Field Help for the <code>server.log.setting.enabled</code> parameter.
EN-107656 EN-109370 EN-109967	5.8.0	VVX phones failed to accept the finalized peer-reflexive ICE candidates published by the far end.
EN-108122	5.8.0	The VVX expansion modules do not refresh the speed dial list after a favorite is added or removed from the phone keys.
EN-108275	5.8.0	VVX phones are freezing and crashing after users press the Group softkey in a Group Call Pickup.
EN-108931	5.8.1	VVX phones are freezing and crashing after users press the Group softkey in a Group Call Pickup.
EN-109131	5.8.0	VVX phones are freezing and crashing after users press the Group softkey in a Group Call Pickup.
EN-109392	5.8.2	After connecting the VVX EM50 expansion module to a VVX 450 phone, the user needs to restart or reboot the phone. Power off the phone before connecting the expansion module.
EN-109712	5.6.0	Polycom terminates NOTIFY line seize BLA dialog event after it gets a 500-internal error with a retry-after 3 seconds from UAS. The parameter <code>voIpProt.SIP.blaGlareHonorRetryAfter</code> was introduced to control this issue.

<i>Issue ID</i>	<i>Release Found In</i>	<i>Description</i>
EN-110931	5.8.0	Do not use basic authentication on VVX phones due to security issues.
EN-111077	5.8.0	A 3-second timer is applied to 911 calls on VVX phones when "[2-9]11" is not at the beginning of the digit map.

What's New in Polycom UC Software 5.8.1

Polycom Unified Communications (UC) Software 5.8.1 is a release for OpenSIP and Skype for Business deployments. These release notes provide important information on software updates, phone features, and known issues.

New Features and Enhancements

Polycom UC Software 5.8.1 includes the following new features and enhancements.

When BToE is enabled and the video-enabled phone is paired to the Skype for Business client on your computer, the preference for transmitting and receiving video streams is given to Skype for Business client. The preference is given to VVX phones only when the phone unpairs with Skype for Business client. You can place all Skype for Business related calls from VVX phones as audio-only irrespective of the call mode selected on the phone. However, users can choose to enable video from the paired Skype for Business client.

Polycom EagleEye Mini Camera Support

VVX 501 and 601 business media phones support the Polycom EagleEye Mini USB camera with all the features and capabilities supported by the Polycom VVX camera.

VVX 501 and VVX 601 business media phones with a connected EagleEye Mini camera support the following features:

- Video stream transmissions up to 1080p with a maximum bit rate of 4 Mbps for AVC calls.
- Microsoft H.264 UC video codec for Skype for Business peer-to-peer video calls and video conference calls.
- Forward Error Correction (FEC) with the Microsoft H.264 UC video codec.
- Simulcast video streams with the Microsoft H.264 UC video codec.
- CCCP video conference calls.
- Quality of Service (QoS) for Skype for Business video calls. The following lists the video and video codec parameters:
 - `video.enable`
 - `video.codecPref.XH264UC`

For more information on configuration details, see Polycom UC Software with Skype for Business - Deployment Guide on Polycom Support.

Forward Error Correction

Polycom phones support Forward Error Correction (FEC) DV0 and DV1 with Skype for Business Server 2015, Skype for Business 2015 client, and Lync 2013 environments for H.264 SVC. The scheme introduces recovery packets on the transmitter which recover lost video packets on the receiver.

FEC performance and quality improvements with this release may vary depending on network conditions.

Use the following parameter to set the FEC codec priority:

- `video.codecPref.XUlpFecUC`

For more information on configuration details, see *Polycom UC Software with Skype for Business - Deployment Guide on Polycom Support*.

Simulcast Video

Polycom phones registered to Skype for Business can simultaneously send a low resolution video stream and a second higher-resolution video stream to conference participants in a Skype for Business AVMCU meeting. The simulcast is enabled by default.

Skype for Business AVMCU-based video meetings is driven by endpoint requests to receive video, which is called a video source request (VSR). The VSR specifies the resolution (among other constraints) and the participant(s) whose video the endpoint would like to display. The requested resolution in Skype for Business client video calls is based on the size of the video window and new VSRs are sent when the size of the window changes.

Centralized Conference Control Protocol (CCCP) Conference View Support

With the support of Polycom EagleEye Mini USB camera, the VVX 501 and 601 business media phones support the Centralized Conference Control Protocol (CCCP) Skype for Business conference view during a video call.

You can configure the phone allowing users to control the Skype for Business conference view during a video call. Users can set the conference view from Conference Settings menu.

Use the following parameter to configure the Skype for Business conference view settings on the phone:

- `video.CCCPView`

For more information on configuration details, see *Polycom UC Software with Skype for Business - Deployment Guide on [Polycom Support](#)*.

Quality of Service (QoS) for Skype for Business Video Calls

With the release and support of the Polycom EagleEye Mini USB camera, the VVX 501 and 601 business media phones support QoS of Skype for Business video calls. You can configure VVX 501 and 601 phones to receive Differentiated Services Code Point (DSCP) for audio and video calls.

You can configure the phones to support QoS of Skype for Business video calls using the following parameters:

- `qos.ip.rtp.dscp`

- `qos.ip.rtp.video.dscp`

For more information on configuration details, see Polycom UC Software with Skype for Business - Deployment Guide on [Polycom Support](#).

Toggleing Between Audio-only or Audio-Video Calls

You can enable users to toggle between audio-only and audio-video calls.

When this feature is enabled on the video-enabled business media phones, a soft key displays to enable users to toggle calls between audio-only or audio-video. This feature also applies to audio and video conference calls in Skype for Business environments.

When the phone is registered, you can:

- Use `video.callMode.default` parameter to begin calls as audio-video or audio only. By default, calls begin as audio. After a video call has ended, the phone returns to audio-only.
- If you set this parameter to audio, users can choose to add a video to the call.
- Use `feature.audioVideoToggle.enabled` parameter to enable users to choose audio-video before placing a call.
- If set to audio-only, users must choose to use audio-video before the call begins. After the video call ends, the phone returns to audio-only.
- Use `audioVideoToggle.callMode.persistent` parameter to maintain or reset the call mode set by users.

For more information on configuration details, see *Polycom UC Software with Skype for Business - Deployment Guide on Polycom Support*.

Configuration File Enhancements

The following table lists configuration file enhancements that include new or changed parameters for Polycom UC Software Skype for Business profile.

Configuration File Enhancements for UC Software 5.8.1

<i>Template</i>	<i>Parameter</i>	<i>Permitted Values</i>	<i>Change Causes Restart or Reboot</i>
video.cfg	video.enable	To ensure the USB port is disabled on when you set <code>feature.usbTop.power.enabled</code> to 0, you must also disable this parameter. 1 (default) - Enables video in outgoing and incoming calls. 0 - Disables video.	Yes

<i>Template</i>	<i>Parameter</i>	<i>Permitted Values</i>	<i>Change Causes Restart or Reboot</i>
video.cfg	video.allowWithSource	Restricts sending video codec negotiation in Session Description Protocol (SDP) when the camera is not connected. 1 (default) 0 This parameter applies only to VVX 501 and VVX 601 business media phones.	No

What's New in Polycom UC Software 5.8.0

Polycom Unified Communications (UC) Software 5.8.0 is a release for Open SIP and Skype for Business deployments. These release notes provide important information on software updates, phone features, and known issues.

Polycom UC Software 5.8.0 includes the following new features and enhancements:

- Introducing Polycom VVX Business IP Phones
- OpenSIP Enhancements
- Skype for Business Enhancements

Introducing Polycom VVX Business IP Phones

Polycom introduces the following Polycom® VVX® business IP phones:

- VVX 150
- VVX 250
- VVX 350
- VVX 450

These Polycom VVX business IP phones include all the features and functionalities that are currently available for VVX 201, 300 series, and 400 series business media phones, including support for Polycom VVX D60 wireless handsets. These VVX business IP phones support UC Software 5.8.0 and later, and previous versions of UC Software are not supported.

On-Premise Skype for Business Support

The following table shows the Polycom VVX business IP phones with UC Software 5.8.0 that are supported on Skype for Business Server On-Premise.

Microsoft Server Support on VVX Business IP Phones

Phone Model	Skype for Business On-Premises	Microsoft Exchange (On-Premise or Online)	Skype for Business Office 365
VVX 150 business IP phone	No	No	No
VVX 250 business IP phone	Yes	Yes	No
VVX 350 business IP phone	Yes	Yes	No
VVX 450 business IP phone	Yes	Yes	No

OpenSIP Enhancements

Enhanced IPv4 ICMP Management

You can configure your phone to ignore Internet Control Message Protocol (ICMP) redirect requests for an alternate path from the router or gateway. Use the following parameter to configure the Enhanced IPv4 ICMP Management feature:

- `device.icmp.ipv4IcmpIgnoreRedirect`

For configuration details, see the *Polycom UC Software Administrator Guide* on [Polycom Support](#).

Wireless Network Connectivity

Polycom UC Software supports wireless network connectivity using the Polycom® Wi-Fi wireless network adapter (previously known as the 'Obihai Technology wireless adapter' or 'OBiWiFi5G') with all VVX phones except VVX 1500 business media phone. You cannot use Wi-Fi and ethernet simultaneously to connect your VVX phones to the network. Enabling Wi-Fi automatically disables the ethernet port. Polycom UC software supports different wireless network security profiles like Personal and Enterprise mode for better security. VVX phones support EAP-PEAP/MSCHAPv2, EAP-FAST and EAP-TLS methods for Enterprise security mode. VVX phones use 2.4GHz or 5GHz default radio bands.

You can use the following parameters to configure Wireless Network Connectivity: Enable Wi-Fi:

- `device.wifi.enabled`

Wi-Fi Network IP Settings:

- `device.wifi.dhcpEnabled`
- `device.wifi.ipAddress`
- `device.wifi.subnetMask`
- `device.wifi.ipGateway`

Wi-Fi Network Settings:

- `device.wifi.ssid`
- `device.wifi.securityMode`
- `device.wifi.radio.regulatoryDomain`

- `device.wifi.radio.band2_4GHz.enable`
- `device.wifi.radio.band5GHz.enable`

Personal Security (PSK) Wi-Fi Network Settings:

- `device.wifi.psk.keyType`
- `device.wifi.psk.key`

Enterprise based (WPA2-Enterprise) Wi-Fi Network Settings:

- `device.wifi.wpa2Ent.method`
- `device.wifi.wpa2Ent.user`
- `device.wifi.wpa2Ent.password`
- `device.wifi.wpa2Ent.anonid`
- `device.wifi.wpa2Ent.eapFast.inBandProv`

For configuration details, see the *Polycom UC Software Administrator Guide* on [Polycom Support](#).

REST API

VVX phones support REST API feature that enables you to execute certain functions and retrieve information using APIs. You can configure REST API feature using the following parameters:

- `apps.restapi.enabled`
- `log.level.change.restapi`

For more information on REST API support and for configuration details, see the *Polycom UC Software Administrator Guide* and on [Polycom Support](#) and *REST API Reference Manual for Polycom VVX Business Media Phones and Polycom Business IP Phones* at [Polycom Engineering Advisories and Technical Notifications](#).

Uploading Logs to USB Storage Device

Polycom UC Software allows VVX phones to copy application and boot logs to a USB storage device connected to the phone. In addition, you can configure your phone to copy logs periodically or when the file size reaches the threshold limit.

The following VVX phones support this feature:

- VVX 401 business media phones
- VVX 411 business media phones
- VVX 500 series business media phones
- VVX 600 series business media phones
- VVX 250 business IP phones
- VVX 350 business IP phones
- VVX 450 business IP phones

You can configure the USB Logging feature using the following parameter:

- `feature.usbLogging.enabled`

For more information on USB Logging feature and for configuration details, see the *Polycom UC Software Administrator Guide* on [Polycom Support](#).

uaCSTA Lines

When you configure Polycom phones to use user agent Computer Supported Telecommunications Applications (uaCSTA) with a CSTA server, you can remotely control the phone and access phone services using a computer telephony integration (CTI) application on your computer.

The Polycom VVX 101 and 1500 business media phones do not support uaCSTA.

You can configure one CSTA line on each phone. To ensure CSTA works correctly, Polycom recommends that you configure the CSTA line x as the last among all registered lines on the phone.

Polycom phones support the Minimum and Basic profiles compliant with “ECMA TR/087: Using CSTA for SIP Phone User Agents (uaCSTA).” For information, see [ECMA international](#). Polycom phones do not support the Network Reached event.

You can configure CSTA lines using the following parameters:

- `reg.x.csta`
- `reg.x.server.y.specialInterop`
- `voIpProt.SIP.csta`

For a list of all supported CSTA services and events and for configuration details, see the *Polycom UC Software Administrator Guide* on [Polycom Support](#).

Enhancements to Check Sync Event

When a check sync event's NOTIFY message is received from the server even though the user is not logged-in to the phone, you can download the call list by enabling the `voIpProt.SIP.specialEvent.checkSync.downloadCallList` parameter.

Early Media Call Handling Support

Polycom UC Software allows VVX phones to support an early media for call handling when paired with VVX D60 base station.

Voice Quality Monitoring Support for the OPUS Codec

Polycom UC Software now offers partial support for Voice Quality Monitoring metrics when using the OPUS audio codec.

BroadSoft Aggregated Self-Presence

The Broadsoft Self-Presence feature allows you to view the user's aggregated presence received from the BroadSoft Messaging Server (UMS) on the VVX phone rather than displaying the VVX phone's presence.



The following figure shows the user's aggregated presence state on a VVX 600 series business media phone.

Skype for Business Enhancements

Hybrid Line Registration

VVX phones support hybrid line registration feature that allows you to register a Skype for Business server on one line and OpenSIP server on other lines. When you enable this feature, you can configure and register a maximum of three different servers. Use the following parameters to configure Hybrid Line Registration feature:

- `reg.limit`
- `reg.l.mergeServerDigitMapLocally`
- `dialplan.digitmap.lineSwitching.enable`
- `reg.l.urlDialing.enabled`
- `tcpIpApp.port.rtp.lync.audioPortRangeStart`
- `tcpIpApp.port.rtp.lync.videoPortRangeStart`
- `tcpIpApp.port.rtp.lync.audioPortRangeEnd`
- `tcpIpApp.port.rtp.lync.videoPortRangeEnd`

The Polycom VVX 101 business media and VVX 150 business IP phone do not support Hybrid Line Registration.

For more information on Hybrid Line Registration feature and for configuration details, see the *Polycom UC Software with Skype for Business - Deployment Guide* on [Polycom Support](#).

Support for PSTN Gateway on Failover

Polycom UC Software allows your VVX phone to fail over to an alternate PSTN gateway server when the phone gets unregistered due to an outage and the Skype for Business server is not reachable. You can configure the support for PSTN gateway on failover using the following parameters:

- `feature.sfbPstnFailover.enabled`
- `reg.x.server.y.pstnServerAuth.userId`
- `reg.x.server.y.pstnServerAuth.password`

For more information on PSTN Gateway on Failover and for configuration details, see the *Polycom UC Software with Skype for Business - Deployment Guide* on [Polycom Support](#).

Reverse Name Lookup

You can configure phones registered with Skype for Business to display incoming caller names, outgoing recipient names, and the source the phone obtains names from.

The phone displays all Skype for Business participant names for the following functions:

- CCCP conference calls
- Local and remote participants for Boss-Admin calls
- Response group calls
- Team calls
- Voicemails
- Placed, Received, and Missed call lists

If the phone cannot match the number of the incoming or outgoing name to a name in your organization, the phone displays the name given in the SIP signaling.

If a user saves a contact in the phone's local contact directory, the call lists display that name regardless of the priority you configure.

All VVX phones support this Skype for Business feature except the following:

- VVX 101 business media phones
- VVX 150 business IP phones

Configure Reverse Name Lookup with the following parameters:

- `up.ml.priority`

For configuration details, see the *Polycom UC Software with Skype for Business - Deployment Guide* on [Polycom Support](#).

Security Updates

Please refer to the [Polycom Security Center](#) for information about known and resolved security vulnerabilities.

The following table contains the security updates in UC Software 5.8.0.

Security Updates

<i>Category</i>	<i>CVE</i>	<i>Description</i>
Security	CVE-2017-13077, CVE-2017-13078, CVE-2017-13079, CVE-2017-13080, CVE-2017-13081	KRACK: Re-installation of the pairwise encryption key (PTK-TK), group key (GTK), integrity group key (IGTK) in the 4-way handshake and group key (GTK), integrity group key (IGTK) in the group key handshake have been addressed.
Security	CVE-2017-1000250, CVE-2017-1000251	BlueBorne: Linux kernel RCE, Linux Bluetooth stack (BlueZ) information Leak vulnerabilities have been addressed.

Get Help

For more information about installing, configuring, and administering Polycom products, refer to Documents and Downloads at [Polycom Support](#).

To find all Polycom partner solutions, see [Polycom Global Strategic Partner Solutions](#).

The Polycom Community

The [Polycom Community](#) gives you access to the latest developer and support information. Participate in discussion forums to share ideas and solve problems with your colleagues. To register with the Polycom Community, create a Polycom online account. When logged in, you can access Polycom support personnel and participate in developer and support forums to find the latest information on hardware, software, and partner solutions topics.

Copyright and Trademark Information

Copyright© 2019, Polycom, Inc. All rights reserved. No part of this document may be reproduced, translated into another language or format, or transmitted in any form or by any means, electronic or mechanical, for any purpose, without the express written permission of Polycom, Inc.

6001 America Center Drive
San Jose, CA 95002
USA

Trademarks

Polycom®, the Polycom logo and the names and marks associated with Polycom products are trademarks and/or service marks of Polycom, Inc. and are registered and/or common law marks in the United States and various other countries.



All other trademarks are the property of their respective owners. No portion hereof may be reproduced or transmitted in any form or by any means, for any purpose other than the recipient's personal use, without the express written permission of Polycom.

Disclaimer

While Polycom uses reasonable efforts to include accurate and up-to-date information in this document, Polycom makes no warranties or representations as to its accuracy. Polycom assumes no liability or responsibility for any typographical or other errors or omissions in the content of this document.

Limitation of Liability

Polycom and/or its respective suppliers make no representations about the suitability of the information contained in this document for any purpose. Information is provided "as is" without warranty of any kind and is subject to change without notice. The entire risk arising out of its use remains with the recipient. In no event shall Polycom and/or its respective suppliers be liable for any direct, consequential, incidental, special, punitive or other damages whatsoever (including without limitation, damages for loss of business profits, business interruption, or loss of business information), even if Polycom has been advised of the possibility of such damages.

End User License Agreement

BY USING THIS PRODUCT, YOU ARE AGREEING TO THE TERMS OF THE END USER LICENSE AGREEMENT (EULA) AT <http://documents.polycom.com/indexes/licenses>. IF YOU DO NOT AGREE TO THE TERMS OF THE EULA, DO NOT USE THE PRODUCT, AND YOU MAY RETURN IT IN THE ORIGINAL PACKAGING TO THE SELLER FROM WHOM YOU PURCHASED THE PRODUCT.

Patent Information

The accompanying product may be protected by one or more U.S. and foreign patents and/or pending patent applications held by Polycom, Inc.

Open Source Software Used in this Product

This product may contain open source software. You may receive the open source software from Polycom up to three (3) years after the distribution date of the applicable product or software at a charge not greater than the cost to Polycom of shipping or distributing the software to you. To receive software information, as well as the open source software code used in this product, contact Polycom by email at OpenSourceVideo@polycom.com.

Customer Feedback

We are striving to improve our documentation quality and we appreciate your feedback. Email your opinions and comments on DocumentationFeedback@polycom.com.

Polycom Support

Visit [Polycom Support](#) for End User License Agreements, software downloads, product documents, product licenses, troubleshooting tips, service requests, and more.